

20SB KS 气动快换-公头


Pneumatic quick change-male

- 口径 $2,7=5\text{mm}^2$
 - 常用于小型气动、医疗、化学和制药行业
 - 工作压力 $P_B=35\text{bar}$
 - 适用温度：
 - 20°C~+100°C (NBR)
 - 40°C~+120°C (EPDM)
 - 15°C~+200°C (FKM)
- Orifice $2,7=5\text{mm}^2$
 - Commonly used in small pneumatic, medical, chemical and pharmaceutical industries
 - Working pressure $P_B=35\text{bar}$
 - Applicable temperature:
 - 20°C~+100°C (NBR)
 - 40°C~+120°C (EPDM)
 - 15°C~+200°C (FKM)

尺寸		六角	螺纹	型号	产品编码
L1	L2	S1	P1	Type	Product Code
3x4mm	3		M7x0.5	20SB KS04 MPX	QC93000015
				20SB KS04 MPN	QC93000016
3x5mm	3		M7x0.5	20SB KS05 MPX	QC93000017
				20SB KS05 MPN	QC93000018
4x6mm	3.5		M8x0.5	20SB KS06 MPX	QC93000019
				20SB KS06 MPN	QC93000020

注:MPX为标准,MPN为镀镍

Note: MPX is standard, MPN is nickel-plated

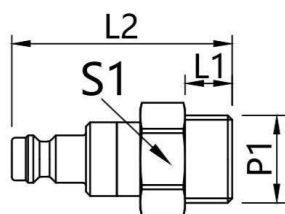

21SB AW/AD 气动快换-公头

Pneumatic quick change-male

- 口径 $5=20\text{mm}^2$
 - 常用于小型气动、医疗、化学和制药行业
 - 工作压力 $P_B=35\text{bar}$
 - 适用温度：
 - 20°C~+100°C (NBR)
 - 40°C~+120°C (EPDM)
 - 15°C~+200°C (FKM)
- Diameter $5 = 20\text{mm}^2$
 - Commonly used in small pneumatic, medical, chemical and pharmaceutical industries
 - Working pressure $P_B = 35\text{bar}$
 - Applicable temperature:
 - 20°C~+100°C (NBR)
 - 40°C~+120°C (EPDM)
 - 15°C~+200°C (FKM)

尺寸		六角	螺纹	型号	产品编码
L1	L2	S1	P1	Type	Product Code
3x4mm		7	M7x0.5	20SF KO04 MXX	QC93000001
				20SF KO04 MXN	QC93000002
3x5mm		7	M7x0.5	20SF KO05 MXX	QC93000003
				20SF KO05 MXN	QC93000004
4x6mm		8	M8x0.5	20SF KO06 MXX	QC93000005
				20SF KO06 MXN	QC93000006

注:MXX为标准,MXN为镀镍

Note: MXX is standard, MXN is nickel-plated